


SPECIFICATIONS

Range: -50 to 300°C,
-58 to 572°F

Resolution: 0.1°C from -20 to 200°C,
1°C outside this range

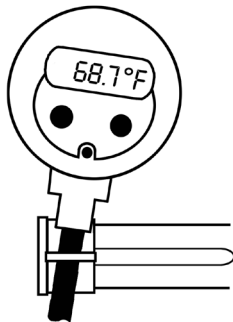

*Insert the probe into
the "loop" on the cover.
It makes a perfect holder.*

FEATURES

- Waterproof and shockproof
- Stainless steel sensor probe
- Max/Min memory recall
- °F/°C selectable
- One second sampling rate
- Protective plastic sleeve with clip and holder
- Low battery indicator

OPERATION

Remove thermometer from the protective sheath. Press ON/OFF button to activate. Press °F/°C button to switch between Fahrenheit and Celsius temperature. Insert probe into the material to be measured and read display.

MAX/MIN MEMORY

To view the minimum temperature reached since activating unit, press MAX/MIN button. "MIN" appears on the display to indicate the minimum temperature recorded. Press MAX/MIN button a second time within 3 seconds to view the maximum temperature reached since activating unit. "MAX" appears on the display to indicate the maximum temperature recorded.

NOTE:

Three seconds after pressing the MAX/MIN button, the unit automatically returns to current sampling mode. Indicators "MIN" and "MAX" are no longer displayed. Turn the unit OFF to reset max/min to current temperature.

ALL OPERATIONAL DIFFICULTIES

If this thermometer does not function properly for any reason, please replace the battery with a new high quality battery (see "Battery Replacement" section). Low battery power can occasionally cause any number of "apparent" operational difficulties. Replacing the battery with a new fresh battery will solve most difficulties.

BATTERY REPLACEMENT

Erratic readings, faint readings or no display are all indications that the battery must be replaced. Using a coin, turn the battery cover on back of the unit in the direction of the "open" arrow. Remove the exhausted battery and replace with a new battery. Make certain the positive (+) side is facing you. Equivalent battery replacements are: RAYOVAC RW42, DURACELL D357, and EVEREADY 357. Replace the battery cover.

**WATER-
RESISTANT
SHOCKPROOF
THERMOMETER
INSTRUCTIONS**